

THE ACS880 WILL NOT START

Description:


The ACS880 will not start from a Digital Input, Fieldbus or Local Control?

Answer:

If the ACS880 drive is firmware revision 2.21.0.0.


| ~ | 7. System info | | | | |
|---|-------------------------|----------------|--------|------------------|--------------|
| 3 | Drive rating id | ACS880-01-04A6 | NoUnit | | Not selected |
| 4 | Firmware name | AINF6 | NoUnit | | |
| 5 | Firmware version | 2.21.0.0 | NoUnit | 0.00.0.0 255.255 | 0.00.0.0 |
| 6 | Loading package name | AINL6 | NoUnit | | |
| 7 | Loading package version | 2.21.0.0 | NoUnit | 0.00.0.0 255.255 | 0.00.0.0 |
| 8 | Bootloader version | 2.11.0.0 | NoUnit | 0.00.0.0 255.255 | 0.00.0.0 |

If you start the Adaptive Programming tool within Drive Composer Pro and click edit.

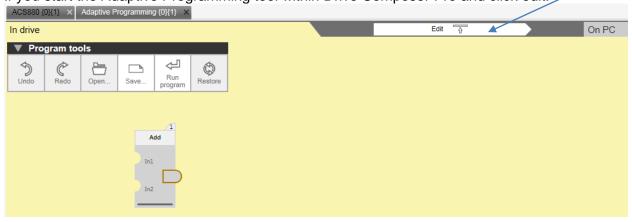

| Author: Jeff Fell – Application | on Eng. | Date: Aug. 20, 2015 | | | |
|--|-----------------------|----------------------------|--|--|--|
| External | | Document #: LVD-EOTN99U-EN | | | |
| http://www.abb.us/drives. | Industry – Industrial | Revision: A | | | |
| Product Categories: ACS880, Drive Composer Pro | | | | | |




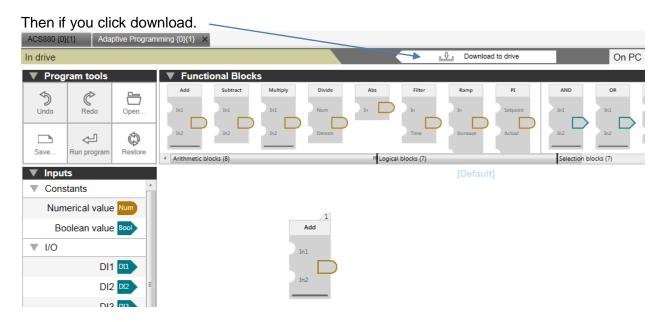

If you exit the Adaptive Programming window without starting the Adaptive Programming the drive will not start from any location.

Corrective Actions:

Start the Adaptive Programming window and click Run Program button, now exit the Adaptive Programming window and the drive will be able to be started.

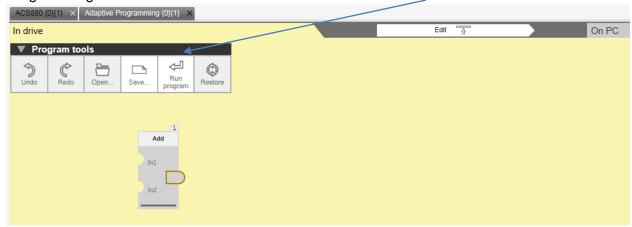

Documents or other reference material:

ACS880 Primary control program Firmware manual 3AUA0000085967

| Author: Jeff Fell – Application | on Eng. | Date: Aug. 20, 2015 | | | |
|--|-----------------------|----------------------------|--|--|--|
| External | | Document #: LVD-EOTN99U-EN | | | |
| http://www.abb.us/drives. | Industry – Industrial | Revision: A | | | |
| Product Categories: ACS880, Drive Composer Pro | | | | | |